

SWITCH-BANK-UPPER

Connector Details

Harness Family: IP

Option: Standard

Color: BLACK

Cavity Count: 10

Gender (Terminal): FEMALE

Connector No: D2321A

Part Number: 15532124

Connector Repair Information

Full Repair Kit: 68496341AA

Terminal Repair Kits: N/A

[FCA Connector Repair Site](#)

Location Views


Location View

Location View Links


[View 2D - View 3D](#)

Connector Views

Mating Side:

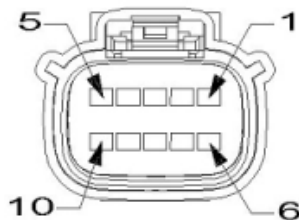

Wire Insertion Side:

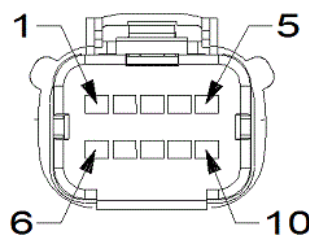

Isometric View:



NOTE: When connector cavities are identified as "NO CONNECT" in the following table, there may be "Dummy (blunt cut) wires" or Cavities may be "Open", "Plugged, or "Flashed over" depending on vehicle option content.

| Pin | Circuit | Wire Color | Gauge/Size | Function | Option |
|-----|---------|------------|------------|-------------------------|-----------------------|
| 1 | A232 | RD/VT | 0.50 | FUSED B(+) | 115V AUX POWER |
| 1 | A232 | RD/VT | 0.75 | FUSED B(+) | EXCEPT 115V AUX POWER |
| 1 | A232 | RD/VT | 0.35 | FUSED B(+) | |
| 2 | N0 | NA | 0 | NO CONNECT | |
| 3 | P820 | BN/OG | 0.35 | AUX 1 RELAY CTRL SIGNAL | |
| 4 | P821 | BN/VT | 0.35 | AUX 2 RELAY CTRL SIGNAL | |
| 5 | N0 | NA | 0 | NO CONNECT | |
| 6 | P822 | BN/WH | 0.35 | AUX 3 RELAY CTRL SIGNAL | |
| 7 | P823 | BN/GY | 0.35 | AUX 4 RELAY CTRL SIGNAL | |
| 8 | N0 | NA | 0 | NO CONNECT | |
| 9 | D401 | OG | 0.35 | LIN BUS CBC 1 | |
| 10 | Z910 | BK | 0.50 | GROUND | |
| 10 | Z910 | BK/YE | 0.50 | GROUND | |