

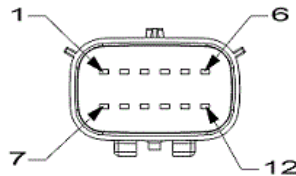
2022 Jeep Truck Gladiator V6-3.6L

Vehicle > Lighting and Horns > Tail Lamp > Diagrams > Connector Views

RIGHT TAIL LAMP ASSEMBLY

LAMP-ASSEMBLY TAIL-RIGHT

Harness
Family: Taillamp_Right

Cavities:14**Color:****Gender:**MALE**Part**
33482-6201**Description:****Connector**
D6642A**No:****Option:**Standard

Pin	Circuit	Wire Color	Gauge/Size	Function	Option
1	L6	GN/	1.0	RIGHT STOP/TURN FEED	EXCEPT EXPORT
1	L54	WH/GN	1.0	RIGHT STOP LAMP DRIVER	EXPORT
2	L144	BG/OG	1.0	RIGHT SIDE MARKER CONTROL	
3	L62	WH/YE	1.0	RIGHT REAR TURN LAMP DRIVER	
4	L72	WH/OG	1.0	RIGHT REAR PARK LAMP DRIVER	
5	L16	WH/VT	1.0	RIGHT BACKUP LAMP DRIVER	
6	Z926	BK/	0.75	GROUND	EXCEPT EXPORT
6	Z926	BK/	1.0	GROUND	EXPORT
7	Z926	BK/	1.0	GROUND	
8	L562	WH/BG	0.50	RIGHT REAR LIGHTING FAULT SENSE	
9	F923	PK/YE	0.50	RUN RELAY CONTROL	
10	D217	DG/WH	0.50	CAN IHS (+)	

11	D218	WH/	0.50	CAN IHS (-)	
12	P712	GN/WH	0.50	RIGHT BLIND SPOT INDICATOR DRIVER	